

Test Report

Report No. : KR-16-00105XA : 1 OF 6 Page No.

Date of Report: Nov. 16,2016

Applicant:

Power Stone Interior Design CO. LTD.

Address:

No.4, Lane 14, Rensiao Rd., Renwu Dist., Kaohsiung City

Sample Name:

Power Stone combined multi-slot board

Sample Submitted By: Test Witnessed By:

Power Stone Interior Design CO. LTD.(David Chuang) Power Stone Interior Design CO. LTD.(David Chuang)

Date of Sample Received: Oct. 28, 2016

Date of Testing: Date of Testing Witness: Nov. 09, 2016 Nov. 09, 2016

Testing Method:

Standard Counterweight

Remark:

The information mentioned in the above section is provided by Client

(Exclude Date of Sample Received and Date of Testing)

## Test Results:

Sample Number	Loading Test		
	Load(kg)	Deflection(mm)	Visual Inspection
No.1	20	4.923	The Standard Counterweight and the Combined multi-slot board were not fallen.  The glass was not broken.
	40	10.091	
	60	13.448	
	70	15.563	
	80	18.249	
	90	21.327	
	100	25.681	

Remark : 1. The size of the glass is  $590(L) \times 290(W) \times 7.8(H)$ mm  $\circ$ 

The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.

 SGS Taiwan Ltd.
 No.86-23, Dehui Rd., Nanzi Dist., Kaohsiung City 811, Taiwan (R.O.C.) / 高雄市楠梓區德惠路86之23號

 台灣檢驗科技股份有限公司
 t (886-7) 301-2121
 f (886-7) 301-1161
 www.sgs.tw




Test Report

Report No. : KR-16-00105XA Page No. : 2 OF 6

Date of Report: Nov. 16,2016

Test Photos:

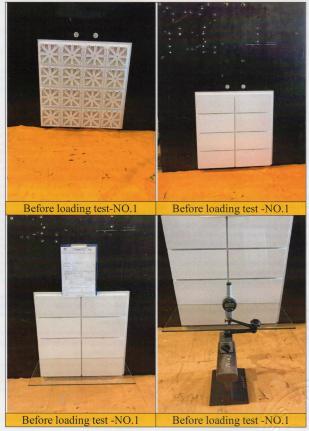

The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.



Test Report

Report No. : KR-16-00105XA
Page No. : 3 OF 6

Date of Report: Nov. 16,2016

Test Photos:





During loading test -NO.1(20kg) During loading test -NO.10





The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.

SGS Taiwan Ltd. No.86-23, Dehui Rd., Nanzi Dist., Kaohsiung City 811, Taiwan (R.O.C.) /高雄市楠梓區德惠路86之23號 www.sgs.tw

t (886-7) 301-2121 f (886-7) 301-1161 www.sgs.tw

Member of SGS Group



Test Report

Report No. : KR-16-00105XA Page No. : 4 OF 6

Date of Report: Nov. 16,2016

Test Photos:



During loading test -NO.1(60kg) During loading test -NO.1(60kg)





During loading test -NO.1(70kg) During loading test -NO.1(70kg)

The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.



Test Report

Report No. : KR-16-00105XA Page No. : 5 OF 6

Date of Report: Nov. 16,2016

Test Photos:



During loading test -NO.1(90kg) During loading test -NO.1(90kg)

The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.




Test Report

Report No. : KR-16-00105XA : 6 OF 6 Page No.

Date of Report: Nov. 16,2016

## Test Photos:

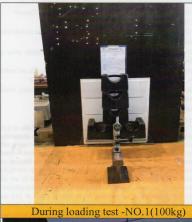



During loading test -NO.1(100kg)



After loading test -NO.1(100kg)



After loading test -NO.1(100kg)

Remark: This Test Report is an additional original report of KR-16-00105X. Issued date: Nov.16.2016.

---- oOo ----

The required specification(s) offered in this test report is/are for reference only. The conformity judgment is at the Applicant's final verdict.

SGS Taiwan Ltd.